

Work Order ID 125974

125974

Page 1

Friday, October 24, 2014 3:01:34 PM

Item ID: D350-748-141TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 10/31/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/31/14 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLS

Date: 14-10-27 Tooling:

Date:

QC:

Date: SPC (Y/N):

Date:

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D350-748-141	G
--------------	---

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio FA648

2-Turn first side as per Folio FA648

3- File transition lines smooth.

FOLIO REV: AF1

DWG REV: G

1 Ø
mom L
14/11/05

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

1 Ø
mom L
14/11/06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge		
☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other		

Work Order ID 125974

Friday, October 24, 2014 3:01:34 PM

125974

Page 2

Item ID: D350-748-141TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 10/31/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/31/14 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

120

Mori Seiki

MORI SEIKI CNC LATHE LARGE

0.00

0.00

Mori Seiki CNC Lathe Large

Memo

1-Turn second side as per Folio FA648
2- File transition lines smooth.
3-Scribe Part & Batch as per Dwg D350-748-141
FOLIO REV: AA
DWG REV: 6

1 0
mmL
14/11/06

130

130

QC

Quality Control

QC1- Inspect dimensions to dimension sheet

0.00

0.00

Memo

1 0
mmL
14/11/06

140

140

QC

Quality Control

QC8- Inspect parts - second check

0.00

0.00

Memo

1 0
DAS
47
9-89
14-11-06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge	☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--	--

Work Order ID 125974

Friday, October 24, 2014 3:01:34 PM

125974

Page 3

Item ID: D350-748-141TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 10/31/14 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 10/31/14 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

0.00

150

Large Fab

0.00

Crosstubes

Memo

Crosstubes

1-DRILL HOLES FOR HEAT TREAT USING DT9806(HOLES MUST BE
ALIGNED ON SAME LINE ON BOTH CUFFS)

2-Grind machining marks

BL 19/11/19

160

Outsource process - Heat Treat

0.00

160

0.00

Outsource1

Memo

Outsource process - Heat Treat

Issue P/O: 26592
Heat Treat to min 180 KSI As per Dwg D350-748-141
(MIL-T-6736 OR AMS 2759-1C)

***Check for straighten and ensure parts are straight within 1/8" as per dwg ***

Sand Blast tube after Heat Treat

Possible Supplier: Vac Aero

Ensure Certificate of Conformity is attached and Metlab process spec form

DAS
46
9-89

14/11/17

CL 14/11/250

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Crosstube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---

Work Order ID 125974

Friday, October 24, 2014 3:01:34 PM

125974

Page 4

Item ID: D350-748-141TRN

Revision ID:

Item Name: Crosstube Turning Detail

Start Date: 10/31/14 Start Qty: 1.00

Required Date: 10/31/14 Req'd Qty: 1.00

Reference:

Accept

N900040100

Setup Start ***NS1***

Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	Receive & Inspect for Damage & Mat'l Certs	0.00							
170									
Packaging	Memo	0.00							
Packaging	Ensure certificate of conformaty is attached								
180	QC6- Inspect dimensions to drawing	0.00							
180									
QC	Memo	0.00							
Quality Control									
190	Packaging	0.00							
190									
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack								
	Location: <u>LG</u>								

/X 8015-015

Side A
2.252
2.247
43 Hrc
Side B
2.306
2.340
2.246
2.234

D 15-01-06 PD

JW 15-01-07

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Crosstube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 125974***125974***

Page 5

Friday, October 24, 2014 3:01:34 PM

Item ID: D350-748-141TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 10/31/14 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/31/14 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

200

QC21- Final Inspection - Work Order Release

0.00

200

QC

Memo

0.00

Quality Control

MLJ

15-01-08

MF
18-1-08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Crosstube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Page 1

Friday, October 24, 2014 3:01:33 PM

Work Order ID: 125974

125974

Parent Item: D350-748-141TRN

D350-748-141TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 10/31/14

Required Date: 10/31/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 08-03-06 DD verified by:ec
IPP Rev B Removed polish 08.04.02 EC verified by : DD
IPP Rev C Remove LPS-3 08.06.23 EC verified by DD IPP Rev C
11.02.24 as per dwg rev.F DD verf: JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6015-125		Manufactured	No			110	Each	85.0000	1	1			

D6015-125

Crosstube Material

Location

Loc Qty

Loc Code

HALL

113255

85

78

95226

7

1 mml 14/11/04

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Crosstube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--


DART AEROSPACE LTD	Work Order: 125979
Description: Crosstube Assembly (AS350/355 High Fwd)	Part Number: D350-748-141
Inspection Dwg: D350-748-141 Rev: G	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.244	/		
	2.180	+0.005/-0.000	2.184	/		
	2.180	+0.005/-0.000	2.183	/		
	2.237	+0.005/-0.000	2.241	/		
	2.272	+0.005/-0.000	2.275	/		
	2.306	+0.005/-0.000	2.310	/		
	2.339	+0.007/-0.000	2.341	/		
	2.339	+0.007/-0.000	2.343	/		
	0.062	+/-0.010	.062	/	vern	CNC-08
	5.25	+/-0.060	5.26	/	"	
	R0.063	+/-0.010	.063	/	RG	
	R0.50	+/-0.030	.500	/	"	
SIDE B	2.240	+0.005/-0.000	2.244	/	vern	CNC-08
	2.180	+0.005/-0.000	2.184	/		
	2.180	+0.005/-0.000	2.184	/		
	2.237	+0.005/-0.000	2.241	/		
	2.272	+0.005/-0.000	2.275	/		
	2.306	+0.005/-0.000	2.311	/		
	2.339	+0.007/-0.000	2.341	/		
	2.339	+0.007/-0.000	2.343	/		
	0.062	+/-0.010	.062	/	vern	CNC-08
	5.25	+/-0.060	5.26	/	"	
	R0.063	+/-0.010	.063	/	RG	
	R0.50	+/-0.030	.500	/	"	
	112.27	+/-0.060	112.27	/	tape	LG-11

DART AEROSPACE LTD	Work Order: 125974
Description: Crosstube Assembly (AS350/355 High Fwd)	Part Number: D350-748-141
Inspection Dwg: D350-748-141 Rev: G	Page 2 of 2

WALL THICKNESS MEASUREMENT

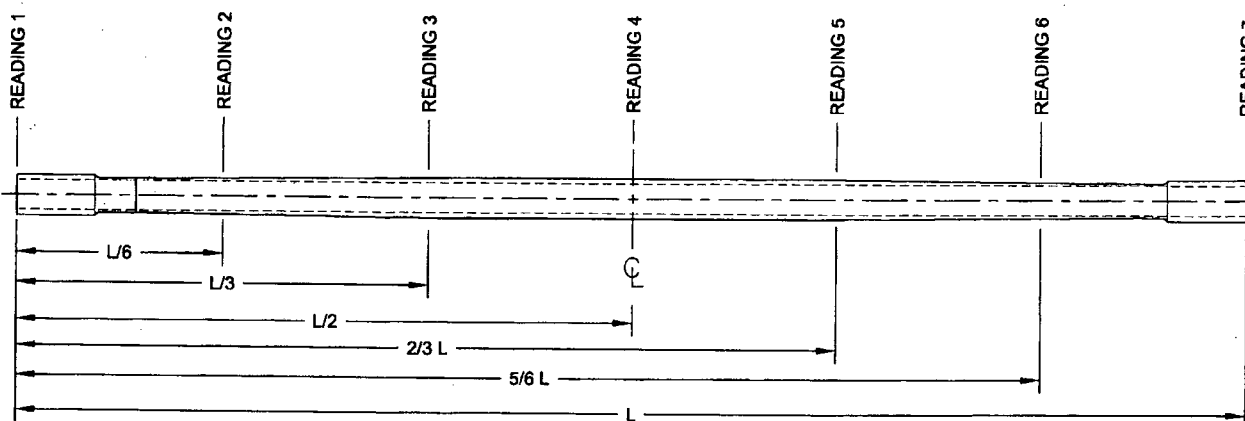

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.124	.133	.127	.119	.014	0.030"
READING 2 L= 18	.123	.130	.135	.130	.012	
READING 3 L= 38	.174	.179	.177	.174	.005	
READING 4 L= 56	.171	.178	.181	.172	.010	
READING 5 L= 74	.175	.179	.179	.175	.004	
READING 6 L= 94	.125	.130	.134	.132	.009	
READING 7 L= 112	.130	.127	.124	.127	.006	

Calibration Result

Actual Block Thickness: .100 .500

Sitescan 250 Measured Thickness: .100 .500

Measured by: <i>mmk</i>
Date: 14/11/06

Audited by: 47
Date: 14-11-06

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
B	07.10.24	Dwg Rev updated (P/O D350-748-101)	KJ/EC/DD	
C	11.01.20	Dwg Rev updated	KJ	
D	11.07.26	Tolerance revised for 2.339 dimensions	KJ	
E	12.06.04	Wall thickness form added	KJ	
F	13.05.08	Dimension 112.27 was 110.27	KJ	
G	14.04.25	5.25 dimension revised to 5.25	KJ	<i>[Signature]</i>

Item	Qty -141	Part Number	Description
1	X	D350-748-141	CROSSTUBE ASSEMBLY (AS 350/355 HI FWD)
2	1	D6015-125	CROSSTUBE (OR D6017-115)
3	2	D3502-1	SUPPORT
4	2	D3595-063-395	RUBBER CUSHION
5	1	AELS-1032-225	INSERT
6	1	NAS1149D0363J	WASHER (OR AN960JD10)
7	2	MS21920-22 OR MS 21920-21	CLAMP (PER DART SPEC. M-MS21920-21/-22)
8	1	MS27039-1-10	SCREW
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6015-125 OR D6017-115
FINISHED LENGTH AFTER TURNING = 112.270±0.06 (AFTER BENDING/TRIMMING = 110.27 REF)
- 2) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-141" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 30.45 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.297 HOLE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

TURNING

- 10) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 11) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS2759/1E AFTER TURNING. ACCEPTABLE TO VERIFY TENSILE STRENGTH BY HARDNESS TEST PER ASTM E18 TO 40-45 HRC.

BENDING

- 12) ALL DIMENSIONS FOR BENT TUBE ARE POST STRESS RELIEF
- 13) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ON TOP HALF OF BEND, AND 7% ON BOTTOM HALF OF BEND.
- 14) MAX AMPLITUDE OF RIBBLING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- 15) AFTER BENDING, STRESS RELIEVE TUBE AT 650°F ±0.25°F FOR A MINIMUM OF 2 HRS AND ALLOW TO COOL TO AMBIENT TEMPERATURE (REF AMS2759/1E).
- 16) MAX TWIST AFTER STRESS RELIEF: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

ASSEMBLY

- 17) TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 18) TORQUE CLAMPS 60 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 125974 MJS

14-10-27

RELEASED
2012-11-01

G	RMV ABRASION STRIP, SUPPORT NOW W/ PROSEAL & CUSHION, ADD STRESS RELIEF, LONGER CUFF, NOW TRIMD AFTER BEND, ADD WALL DIMS & UPDATE TOL	CP	12.09.12
F	ADD HRC TEST OPTION (B8-1) PER PAR 09-040, ADD TWIST LIMIT (A8-1, C1-3), ADD D6015-125 OPTION (C8-1), STOCK DIM NOW MACHINED (D1-4)	CP	10.11.23
E	REVISE GENERAL NOTES; UPDATE TO CURRENT ADD STANDARDS, RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); TOLERANCES (ZN C6-3, D1-3)	RF	09.09.30
D	MAG. PARTICLE AND CAD PLATE AS MFD.	CP	06.10.31
C	ADD CAD PLATING	CP	06.08.14
B	ADD D6017-115 & PRIME AND PAINT	CP	06.06.30
A	NEW ISSUE	CP	06.03.31
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	12.09.12		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA			
DRAWING NO.		REV. G	
D350-748-141		SHEET 1 OF 4	
TITLE		SCALE	
CROSSTUBE (AS 350/355 HI FWD)		NTS	
COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1

D

C

B


A

D


C

B

A

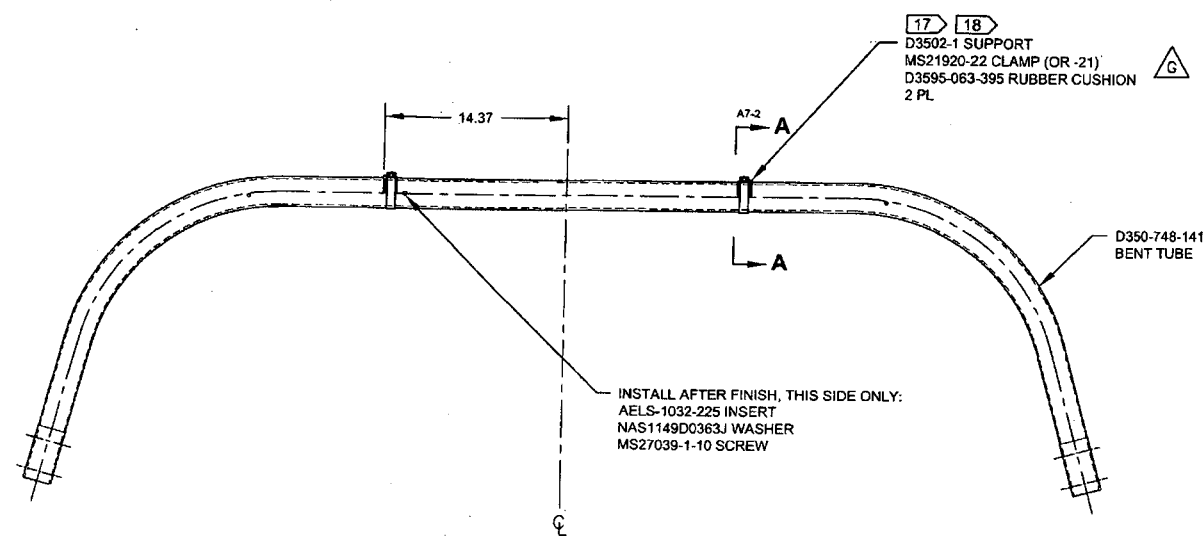

**D350-748-141
ASSEMBLY DETAIL**

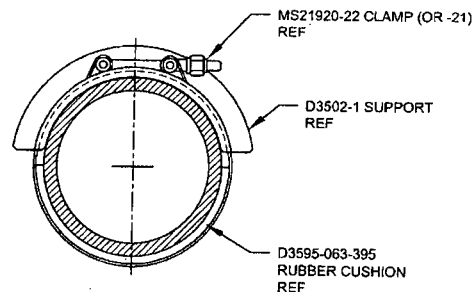


SECTION A-A D4-2
SCALE 6X



RELEASED
2012-11-03

DESIGN	00	DART AEROSPACE LTD	
DRAWN	00	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AV	DRAWING NO.	REV. G
MFG. APPR.		D350-748-141	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	12.09.12	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

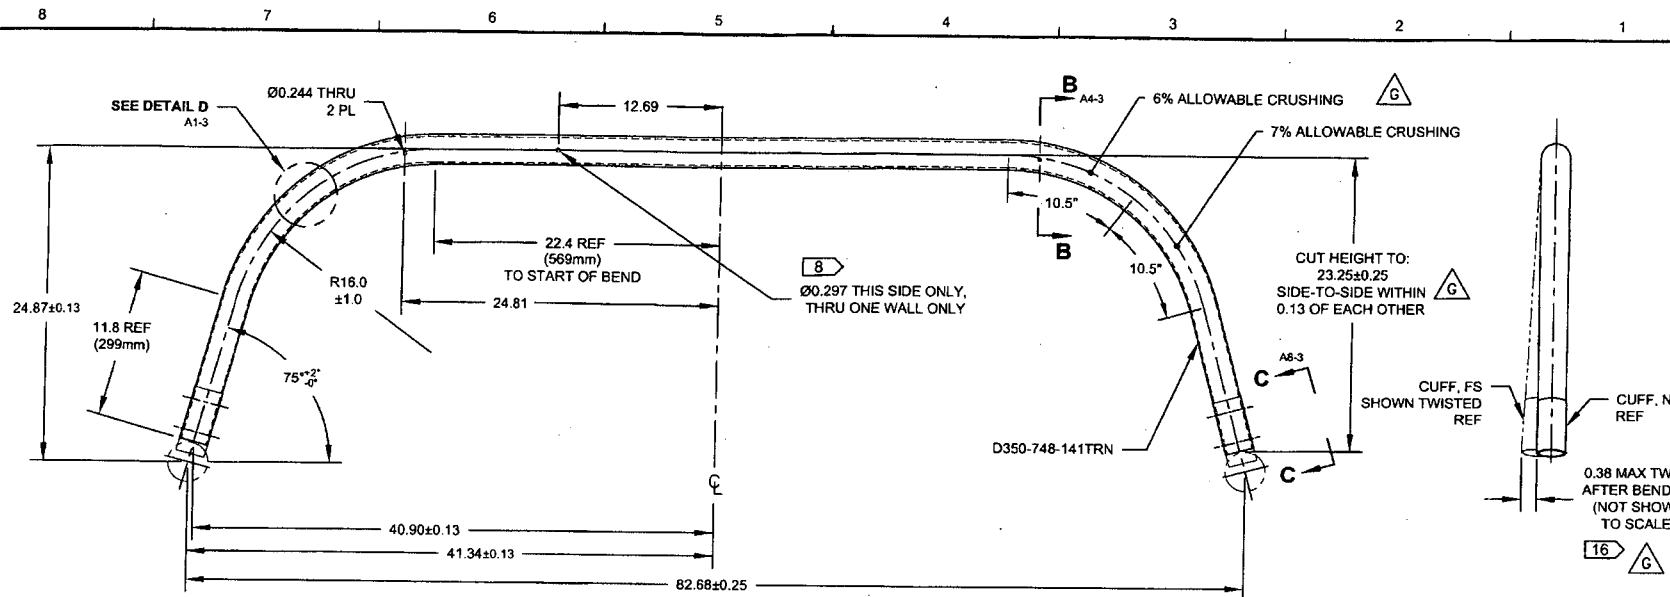

D350-748-141
BENDING AND DRILLING DETAIL 13

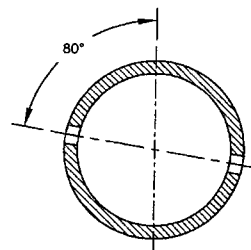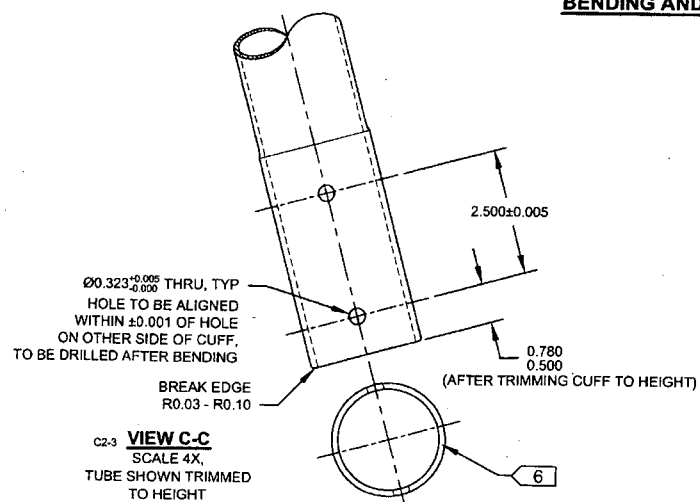


SECTION B-B 03-3
SCALE 6X

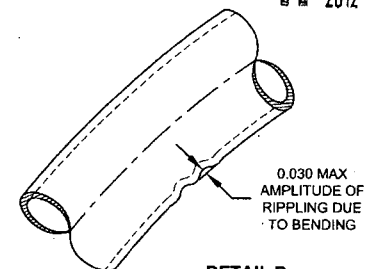

DETAIL D D7-3
SCALE 4X
RIPPING EXAGGERATED


DESIGN	<i>g</i>	DART AEROSPACE LTD	
DRAWN	<i>g</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>W.P.</i>	D350-748-141	SHEET 3 OF 4
APPROVED	<i>W.P.</i>	TITLE	SCALE
DE APPR.	<i>W.P.</i>	CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	12.09.12	COPYRIGHT © 2005 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR ANY COMMUNICATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

RELEASED
2012-11-01

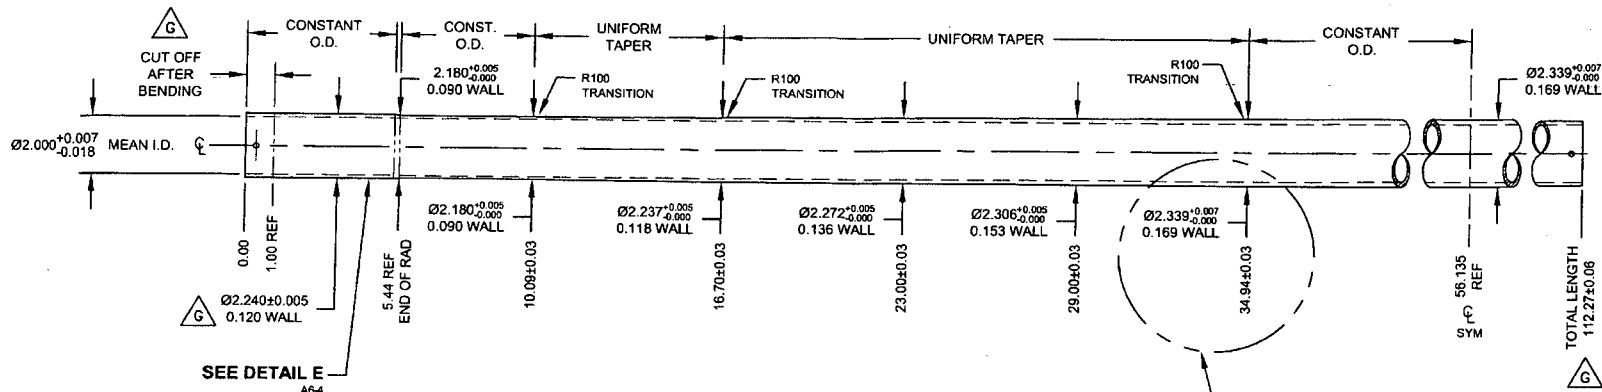


**D350-748-141TRN
TURNING DETAIL**


RELEASED
2012-11-01

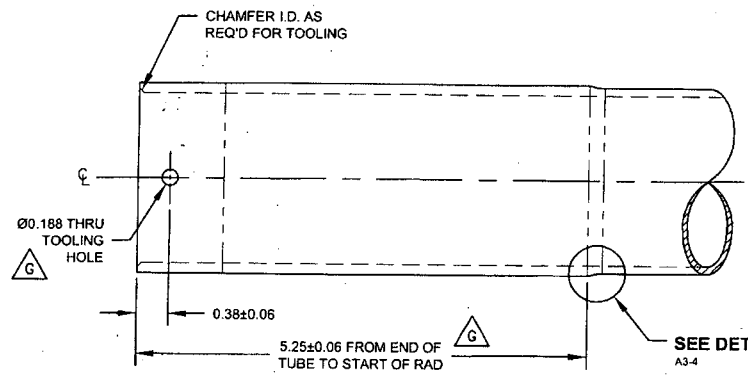

**DETAIL E:
CROSSTUBE CUFF**
SCALE 3X

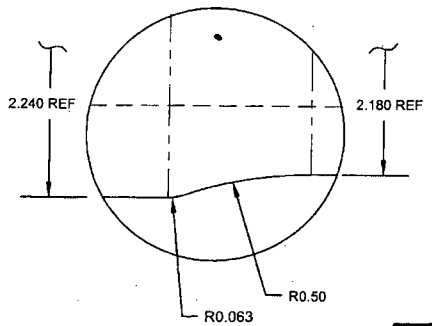

**DETAIL G:
CUFF TRANSITION**
NOT TO SCALE

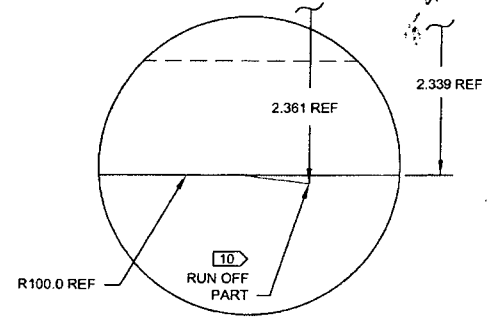

**DETAIL F:
TOOL RUN-OFF**
NOT TO SCALE

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D350-748-141	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	12.09.12	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO26592**

Purchase Order Date 11/21/2014

PO Print Date 11/21/2014

Page Number 3 of 9

Order From :

METLAB
1000 E. MERMAID LANE
WYNDMOOR, PA 19038
USA

VU-MET001

Ship To : DART AEROSPACE LTD

1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone 215-233-2600

Ship To Contact

Ship To Phone

Ship Via: Day & Ross collect

Ship Acct:

Buyer

Chantal Lavoie

Customer POID

Customer Tax #

10127-2607

Terms

Net 30

Currency

USD

FOB

FCA - (Free Carrier)

6	125974	D350-748-141TRN CROSSTUBE	12/15/2014	1.00	\$205.00	\$205.00
---	--------	------------------------------	------------	------	----------	----------

Yes

12/15/2014

SAME AS ABOVE

SP 15-01-05

Line Total: \$205.00

7	125975	D350-748-141TRN CROSSTUBE	12/15/2014	1.00	\$205.00	\$205.00
---	--------	------------------------------	------------	------	----------	----------

Yes

12/15/2014

SAME AS ABOVE

Line Total: \$205.00

8	125976	D350-748-141TRN CROSSTUBE	12/15/2014	1.00	\$205.00	\$205.00
---	--------	------------------------------	------------	------	----------	----------

Yes

12/15/2014

SAME AS ABOVE

Line Total: \$205.00

Note:

11/21/2014

Packing Li

Sales Order Numl

855

Sales Order D.

Dec 4, 20

Pa

METLAB**1000 E. MERMAID LANE****WYNDMOOR, PA 19038**

Voice: 215-233-2600

Fax: 215-233-5653

Sold To:

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURY, ON K6A 1K7
CANADA

Ship To:

DART AEROSPACE
1270 ABERDEEN STREET
HAWKESBURY, ON K6A 1K7
CANADA

Customer ID	PO Number	Payment Terms
DARA	PO26502	Net 30 Days
Ship Via	Process	
CALL CUSTOMER	HT	

Quantity	Item	Description	Total Shipped	This Shipme
23.00		23 PCS. D350-748-141TRN CROSSTUBE HEAT TREAT TO 180 KSI PER MIL-T-6736 OR AMS 2759-1C. SANDBLAST CLEAN. STRAIGHT WITHIN 1/8" PER DWG 1,000 POUNDS		
1.00	CERT.			

COMMENTS

SHIPPED BY, SIGNATURE
METLAB12/29/14
DATERECEIVED BY, SIGNATURE
DART AEROSPACE

DATE



1000 E. Mermaid La., Wyndmoor (Phila.) PA 19038-8093
Tel. (215) 233-2600 Fax (215) 233-5653

Certification

SOLD TO

Dart Aerospace
1270 Aberdeen St.
Hawkesbury, ON K6A 1K7
Canada

December 27, 2014

Metlab Shop Order:	85547
Purchase Order:	PO 26592
Description:	D350-748-141TRN, D350-748-241TRN
Part No:	125968, 125969, 125940, 125971, 125972, 125974, 125975, 125976, 125990, 125991, 125992, 125993, 125994, 15977, 125998, 125999, 12600, 125997, 126002, 126003, 126004, 126005, 12606
Material:	4130 Alloy Steel
Quantity:	23 Pieces (14, 9)
Weight:	1,000 Pounds Total
Specifications:	Harden and temper to 180 KSI minimum ultimate tensile strength per AMS 2759-1C

SP15-01-5

This is to certify that the above parts were processed as indicated above and conform to the specification requirements.


Results:

Ultimate Tensile Strength: 194/215 KSI*

Surface Hardness: 42/45 HRC

*Approximated from surface hardness

METLAB

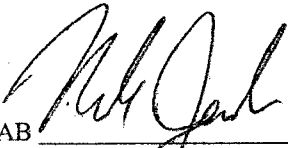
Quality Representative Mark Jenkins

MERCURY CONTAMINATION: During the heat treating process, testing and inspections, the product did not come in direct contact with mercury or any of its compounds nor with any mercury containing device.mj



Heat Treating and Metallurgical Consulting

